


197-123




98-133

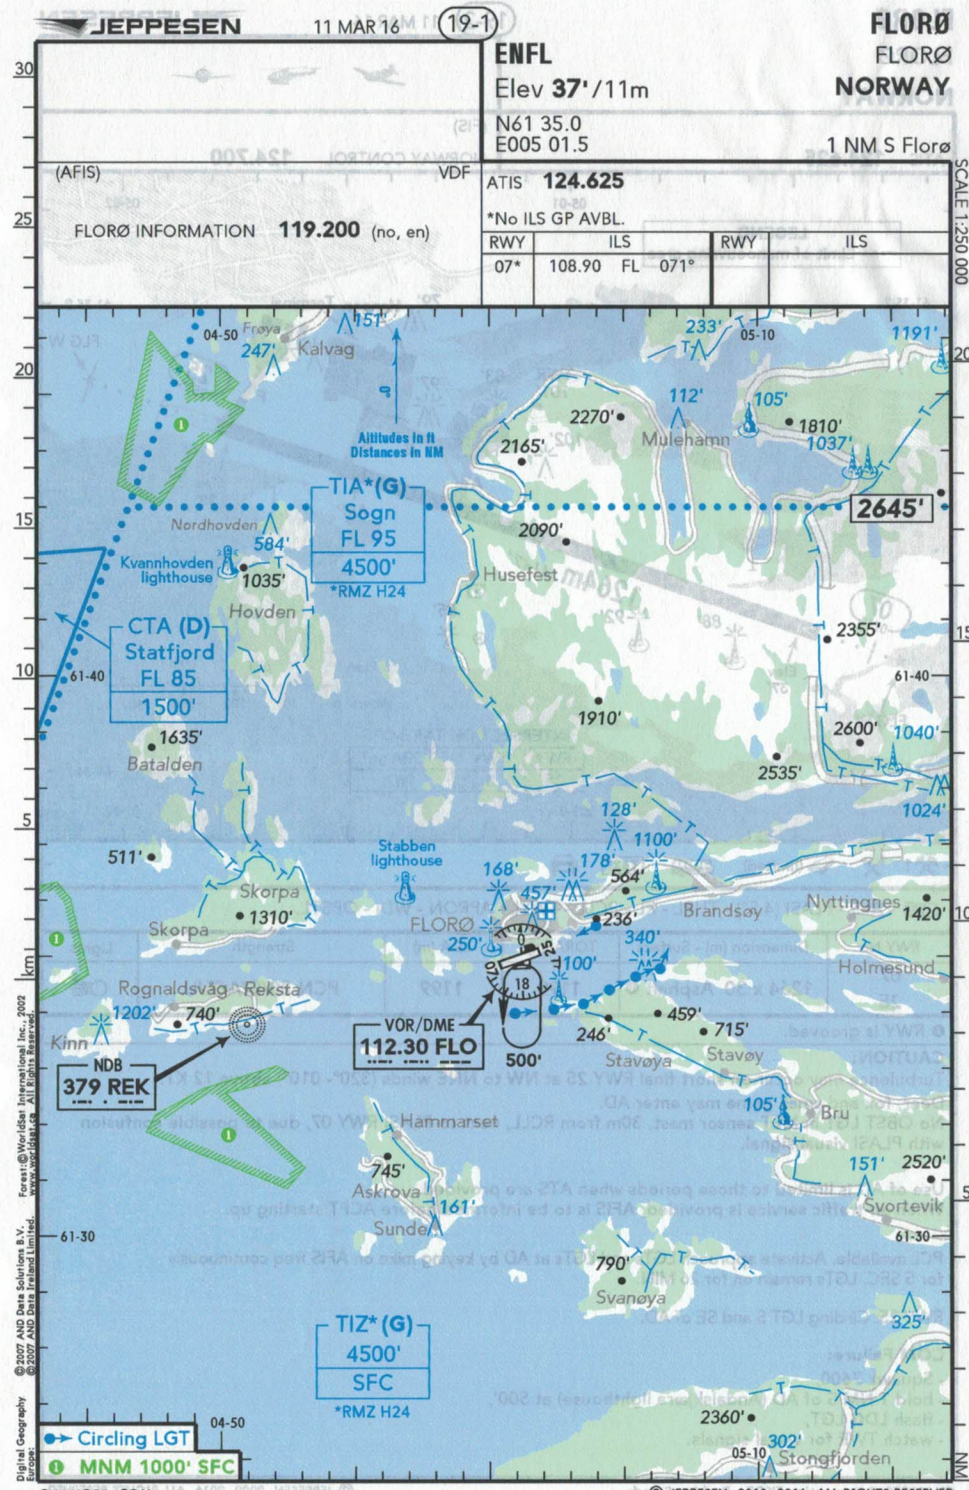

HAMMERFEST
NORWAY

(19-2) 30 SEP 11

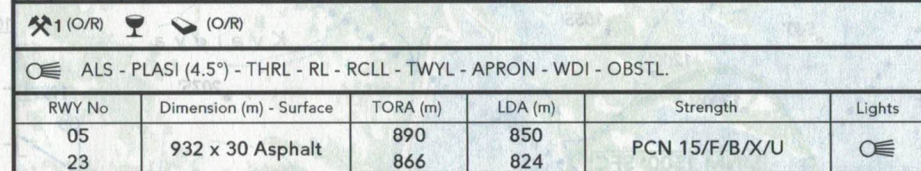JEPPESSEN

CAUTION:

Turbulence/wind shear/downdraft may occur on final RWY 05 and 23. Wind 280°-030° and 120°-190°. Moderate, occasionally severe turbulence, may occur on short final RWY 05 and 23. Wind 280°-030° and 120°-190°. 15 KT or more.

Severe turbulence may occur on short final RWY 05 and 23. Wind 290°-360°, 20 KT or more.

Large bird concentrations (seagulls) may occur during summer season, mainly N of RWY.

PCL AVBL. Activate ALS and RL by keying mike on AFIS frequency continuously for at least 5 seconds. Lights remain on for 26 MIN.

COM Failure:


- Squawk 7600,
- hold 1 NM S of THR 05 at 1200',
- flash LDG LGT,
- watch TWR for visual signals.

CHANGES: QFU - Holding Position - Text.

FLORØ
NORWAY

(19-2) 11 MAR 16

JEPPESEN

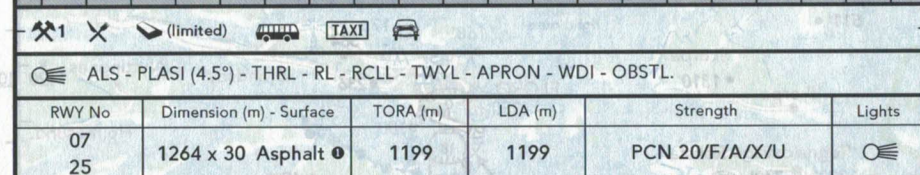

① RWY is grooved.

CAUTION:

Turbulence may occur on short final RWY 25 at NW to NNE winds (320°- 010°) above 12 KT.

Deer, fox and small game may enter AD.

No OBST LGT in MET sensor mast, 30m from RCLL, next to PLASI RWY 07, due to possible confusion with PLASI visual signal.

Use of AD is limited to those periods when ATS are provided.

When air traffic service is provided, AFIS is to be informed before ACFT starting up.

PCL available. Activate approach LGTs and LGTs at AD by keying mike on AFIS freq continuously for 5 SEC. LGTs remain on for 26 MIN.

RWY 25: Circling LGT S and SE of AD.

COM Failure:

- Squawk 7600,
- hold 1 NM S of AD (Andalskjæra lighthouse) at 500',
- flash LDG LGT,
- watch TWR for visual signals.

CHANGES: Intersection TKOF - Parking Stands.

© JEPPESEN, 2009, 2016. ALL RIGHTS RESERVED.